



Operating Instructions and Parts Manual

Magnetic Box and Pan Brake

Model BB-7216M-V2



Baileigh Industrial
P.O. Box 531
Manitowoc, WI 54221-0531
Ph.: 920-684-4990
Fax: 920-684-3944
Baileigh-Sales@jpwindustries.com

Edition 1 11/2025
Copyright ©2025 Baileigh Industrial

1.0 Table of Contents

Section	Page
1.0 Table of Contents	2
2.0 Safety Instructions	3
3.0 About This Manual	5
4.0 Product Identification	6
4.1 Overall Dimensions	6
5.0 Specifications	7
6.0 Setup and Assembly	8
6.1 Unpacking and Checking Contents	8
6.2 Cleaning	8
6.3 Transporting and Lifting	9
6.4 Installation	9
6.5 Assembly	10
7.0 Electrical	11
7.1 Power Specifications	11
7.2 Considerations	11
7.3 Power Cord Connection	12
8.0 Operation	12
8.1 Sheet Metal Bending	12
8.2 Bending Edges of Materials	13
8.3 Magnetism Notes	14
9.0 Bending Allowance	14
10.0 Understanding Springback	14
11.0 Material Selection	14
12.0 Bend Configurations	14
13.0 Bending Examples	14
13.1 Folding Over a Lip	14
13.2 Rolling an Edge	15
13.3 Making a Box with Clamping Bars	15
13.4 Forming Pans with Slotted Clamp Bar	15
14.0 Maintenance	16
14.1 Checking Machine Accuracy	16
14.2 Checking the Gap	16
15.0 Troubleshooting	17
15.1 Full Clamping Not Operating	17
15.2 Clamp Bar Not Being Released	17
16.0 Replacement Parts	18
16.1.1 Magnetic Box and Pan Brake Assembly – Exploded View	18
16.1.2 Magnetic Box and Pan Brake Assembly – Parts List	19
17.0 Wiring Diagram	21
17.1 Wiring Components	22
18.0 Warranty and Service	23



2.0 Safety Instructions

⚠ WARNING

Failure to follow these rules may result in serious personal injury

1. FOR YOUR OWN SAFETY, READ INSTRUCTION MANUAL BEFORE OPERATING THE MACHINE. Learn the machine's application and limitations as well as the specific hazards.
2. Only trained and qualified personnel can operate this machine.
3. Make sure guards are in place and in proper working order before operating machinery.
4. Remove any adjusting tools. Before operating the machine, make sure any adjusting tools have been removed.
5. Keep work area clean. Cluttered areas invite injuries.
6. Overloading machine. By overloading the machine, you may cause injury from flying parts. DO NOT exceed the specified machine capacities.
7. Dressing material edges. Always chamfer and deburr all sharp edges.
8. Do not force tool. Your machine will do a better and safer job if used as intended. DO NOT use inappropriate attachments in an attempt to exceed the machines rated capacity.
9. Use the right tool for the job. DO NOT attempt to force a small tool or attachment to do the work of a large industrial tool. DO NOT use a tool for a purpose for which it was not intended.
10. Dress appropriate. DO NOT wear loose fitting clothing or jewelry as they can be caught in moving machine parts. Protective clothing and steel toe shoes are recommended when using machinery. Wear a restrictive hair covering to contain long hair.
11. Use eye protection. Always wear ISO approved protective eye wear when operating machinery. Wear a full-face shield if you are producing metal filings. Eye wear shall be impact resistant, protective safety glasses with side shields which comply with ANSI Z87.1 specification.
12. Do not overreach. Maintain proper footing and balance at all times. DO NOT reach over or across a running machine.
13. Stay alert. Watch what you are doing and use common sense. DO NOT operate any tool or machine when you are tired.
14. Check for damaged parts. Before using any tool or machine, carefully check any part that appears damaged. Check for alignment and binding of moving parts that may affect proper machine operation.
15. Observe work area conditions. DO NOT use machines or power tools in damp or wet locations. Do not expose to rain. Keep work area well lighted. DO NOT use electrically powered tools in the presence of flammable gases or liquids.
16. Keep children away. Children must never be allowed in the work area. DO NOT let them handle machines, tools, or extension cords.
17. Store idle equipment. When not in use, tools must be stored in a dry location to inhibit rust. Always lock up tools and keep them out of reach of children.
18. DO NOT operate machine if under the influence of alcohol or drugs. Read warning labels on prescriptions. If there is any doubt, DO NOT operate the machine.
19. Turn off power before checking, cleaning, or replacing any parts.
20. Be sure all equipment is properly installed and grounded according to national, state, and local codes.
21. Keep all cords dry, free from grease and oil, and protected from sparks and hot metal.
22. Inspect power and control cables periodically. Replace if damaged or bare wires are exposed. Bare wiring can kill! DO NOT touch live electrical components or parts.
23. DO NOT bypass or defeat any safety interlock systems.
24. Keep visitors a safe distance from the work area.

Familiarize yourself with the following safety notices used in this manual:



This means that if precautions are not heeded, it may result in minor injury and/or machine damage.



This means that if precautions are not heeded, it may result in serious injury or death.



This means that if precautions are not heeded, it will result in serious or fatal, injury.

Save the Instructions

3.0 About This Manual

This manual is provided by Baileigh Industrial, covering the safe operation and maintenance procedures for a Baileigh Model BB-7216M-V2 Magnetic Box and Pan Brake. This manual contains instructions on installation, safety precautions, general operating procedures, maintenance instructions and parts breakdown. Your machine has been designed and constructed to provide consistent, long-term operation if used in accordance with the instructions as set forth in this document.

Technical Support handles questions on setup, operation, schematics, warranty issues, and individual parts needed. Our Technical Support department can be reached at 920-684-4990.

If there are questions or comments, please contact your local supplier or Baileigh Industrial. We can also be reached at our web site: www.baileigh.com.

Retain this manual for future reference. If the machine transfers ownership, the manual should accompany it.

WARNING

Read and understand the entire contents of this manual before attempting assembly or operation! Failure to comply may cause serious injury!

Register your product online -

<https://baileigh.com/product-registration>



4.0 Product Identification

4.1 Overall Dimensions

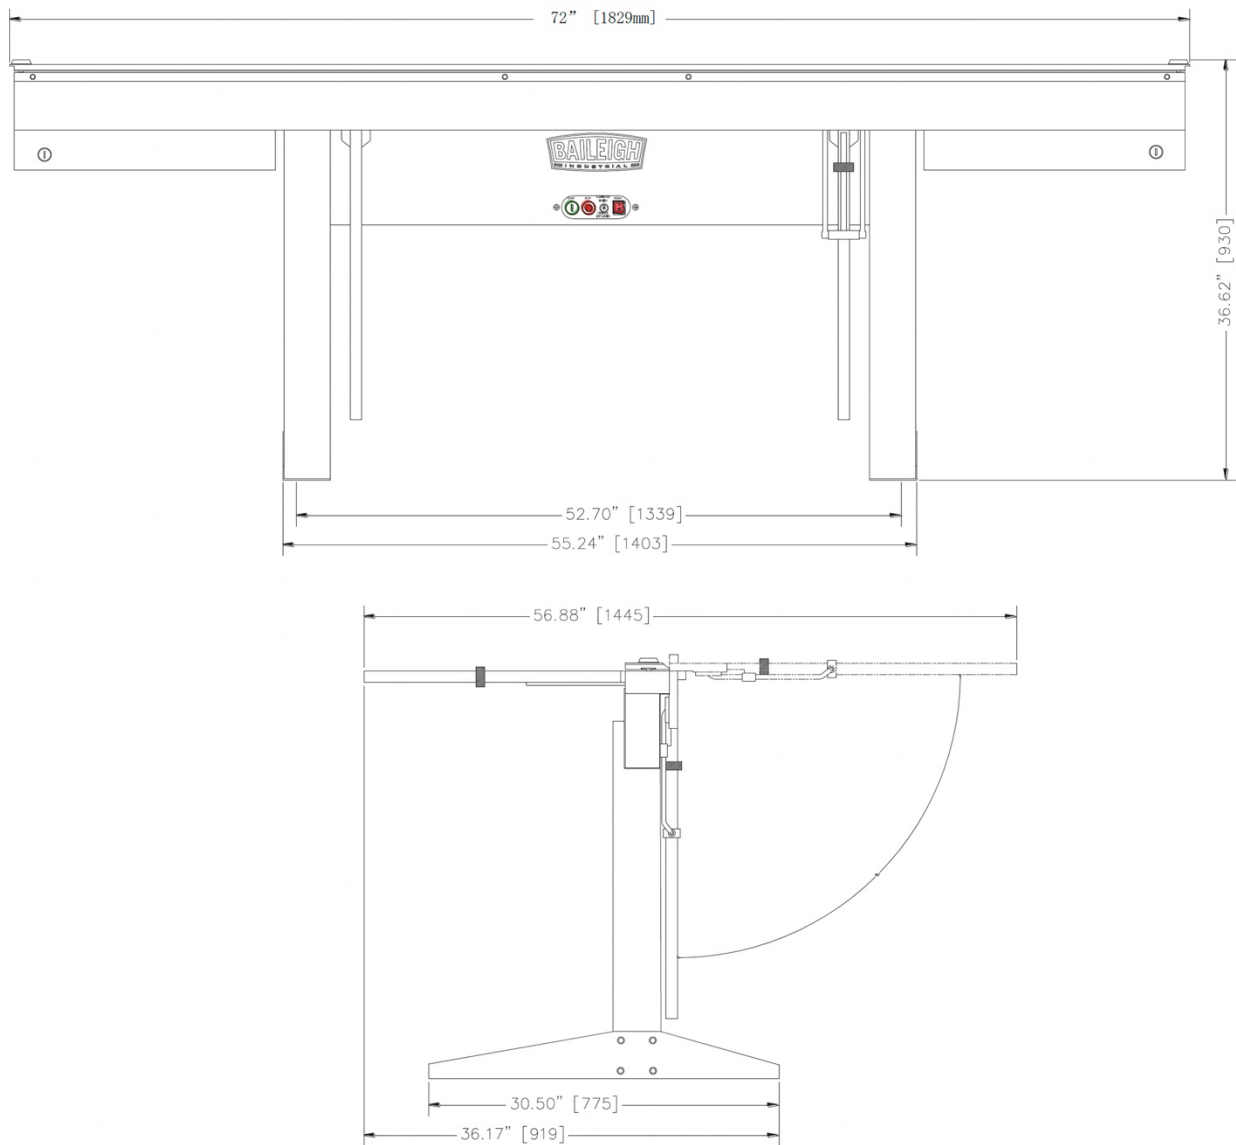


Figure 4-1

5.0 Specifications

Table 5-1

Model Number	BB-7216M-V2
General Specifications	
Bend Length	72" (1829mm)
Bend Material Thickness	16ga. (1.51mm) mild steel*
Bending Leaf Extension Removed	20ga. (0.91mm) stainless steel**
Bend Material Thickness	18ga. (1.21mm) mild steel*
Bending Leaf Extension Installed	21ga. (0.83mm) stainless steel**
Bend Angle	0 – 180 degrees
Box Depth	Unlimited
Clamping Force	6 ton (5443kg)
Minimum Depth Under Clamping Bar	2" (51mm)
Power	220V, 1ph, 60Hz, 12A
Duty Cycle	30%
Thermal Cut-Out	158°F (70°C)
Weights and Dimensions	
Shipping Dimensions (L x W x H)	86.6" x 13.8" x 16.5" (2200 x 350 x 420mm)
Shipping Weight	595 lbs. (270 kg)
Based on a material tensile strength of *60,000 PSI – mild steel	
**100,000 PSI – stainless steel	
‡Maximum capacity listed is obtained with the bending leaf extension removed.	

! WARNING

Read and understand the entire contents of this manual before attempting assembly or operation. Failure to comply may cause serious injury.

6.0 Setup and Assembly

6.1 Unpacking and Checking Contents

Your Baileigh machine is shipped complete. Separate all parts from the packing material and check each item carefully. Make certain all items are accounted for before discarding any packing material.

! WARNING

SUFFOCATION HAZARD! Immediately discard any plastic bags and packing materials to eliminate choking and suffocation hazards to children and animals.

! WARNING

If any parts are missing, DO NOT place the machine into service until the missing parts are obtained and installed correctly.

6.2 Cleaning

! WARNING

DO NOT USE gasoline or other petroleum products to clean the machine. They have low flash points and can explode or cause fire.

! CAUTION

When using cleaning solvents work in a well-ventilated area. Many cleaning solvents are toxic if inhaled.

Your machine may be shipped with a rustproof waxy coating and/or grease on the exposed unpainted metal surfaces. Fully and completely remove this protective coating using a degreaser or solvent cleaner. Moving items will need to be moved along their travel path to allow for cleaning the entire surface. For a more thorough cleaning, some parts may need to be removed. **DO NOT USE** acetone or brake cleaner as they may damage painted surfaces.

Follow manufacturer's label instructions when using any type of cleaning product. After cleaning, wipe unpainted metal surfaces with a light coating of quality oil or grease for protection.

IMPORTANT: This waxy coating is NOT a lubricant and will cause the machine to stick and lose performance as the coating continues to dry.

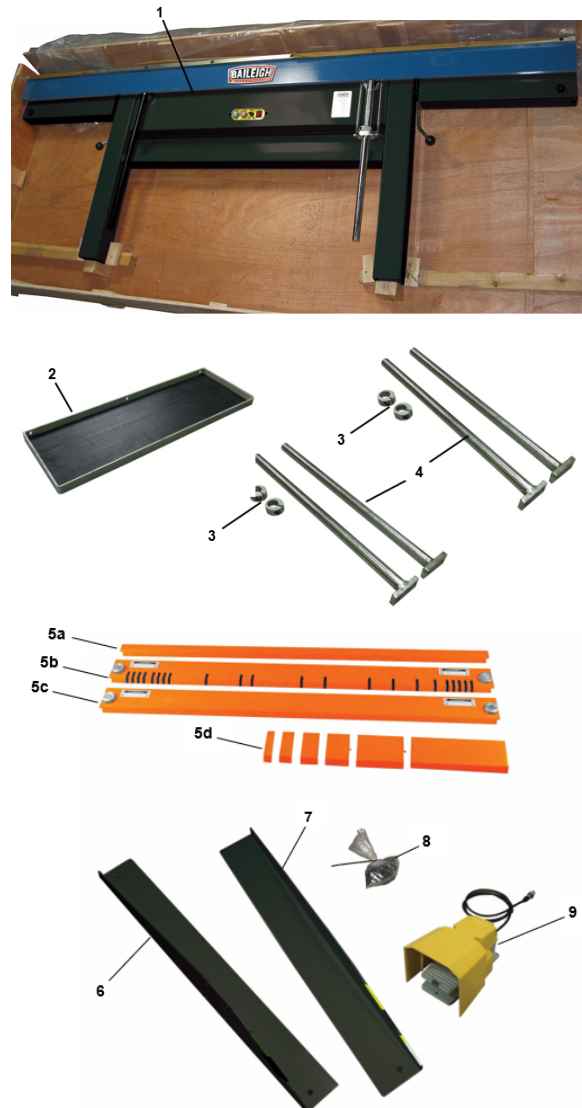


Figure 6-1

Table 6-1

Item	Description	Qty.
1	Body and Pedestal	1
2	Tool Tray	1
3	Back Stop Collars	4
4	Back Stop Bars	4
5a	Narrow Clamp Bar (1250mm length)	1
5b	Notched Clamp Bar (1250mm length)	1
5c	Wide Clamp Bar (Full Length-2500mm)	1
5d	Segmented Clamp Bars (25mm, 37.5mm, 52.5mm, 70mm, 140mm, & 280mm)	1
6	Left Foot	1
7	Right Foot	1
8	Bag of Hardware	1
9	Foot Switch	1

6.3 Transporting and Lifting

NOTICE

Lifting and carrying operations should be performed by skilled workers, such as truck or crane operators. If a crane is used to lift the machine, attach the lifting chain carefully, making sure the machine is well balanced.

Follow these guidelines when lifting with truck or trolley:

- The lift truck must be able to lift at least 1.5 – 2 times the machines gross weight.
- Make sure the machine is balanced. While transporting, avoid rough or jerky motion, and maintain a safe clearance zone around the transport area.

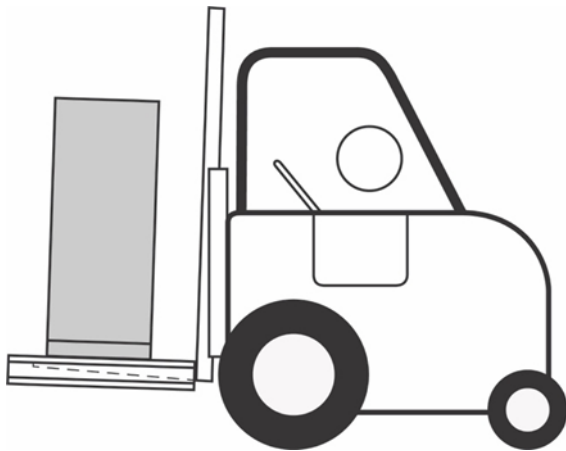


Figure 6-2

- Use a forklift with sufficient lifting capacity and forks that are long enough to reach the complete width of the machine.
- Remove the securing bolts that attach the machine to the pallet.
- Approaching the machine from the side, lift the machine on the frame taking care that there are no cables or pipes in the area of the forks.
- Move the machine to the required position and lower gently to the floor.
- Level the machine so that all the supporting feet are taking the weight of the machine and no rocking is taking place.

Follow these guidelines when lifting crane or hoist:

- Always lift and carry the machine with the lifting holes provided at the top of the machine.
- Use lift equipment such as straps, chains, capable of lifting 1.5 to 2 times the weight of the machine.
- Take proper precautions for handling and lifting.
- Check if the load is properly balanced by lifting it an inch or two.

- Lift the machine, avoiding sudden accelerations or quick changes of direction.
- Locate the machine where it is to be installed, then lower slowly until it touches the floor.

6.4 Installation

IMPORTANT:

Consider the following when looking for a suitable location to place the machine:

- Overall weight of the machine.
- Weight of material being processed.
- Sizes of material to be processed through the machine.
- Space needed for auxiliary stands, work tables, or other machinery.
- Clearance from walls and other obstacles.
- Maintain an adequate working area around the machine for safety.
- Have the work area well illuminated with proper lighting.
- Keep the floor free of oil and make sure it is not slippery.
- Remove scrap and waste materials regularly, and make sure the work area is free from obstructing objects.
- If long lengths of material are to be fed into the machine, make sure that they will not extend into any aisles.
- **LEVELING:** The machine should be sited on a level, concrete floor. Provisions for securing it should be in position prior to placing the machine. The accuracy of any machine depends on the precise placement of it to the mounting surface.
- **FLOOR:** This tool distributes a large amount of weight over a small area. Make certain that the floor is capable of supporting the weight of the machine, work stock, and the operator. The floor should also be a level surface. If the unit wobbles or rocks once in place, be sure to eliminate by using shims.
- **WORKING CLEARANCES:** Take into consideration the size of the material to be processed. Make sure that you allow enough space for you to operate the machine freely.
- **POWER SUPPLY PLACEMENT:** The power supply should be located close enough to the machine so that the power cord is not in an area where it would cause a tripping hazard. Be sure to observe all electrical codes if installing new circuits and/or outlets.

6.4.1 Anchoring the Machine

- Once positioned, anchor the machine to the floor, as shown in the diagram. Use bolts and expansion plugs or sunken tie rods that connect

through and are sized for the holes in the base of the stand.

- This machine requires a solid floor such as concrete at a minimum of 4" (102mm) thick. 6" (153mm) minimum is preferred.

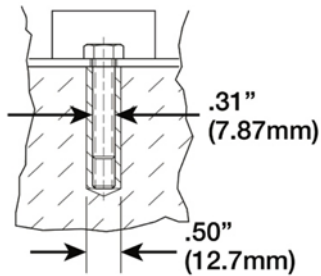


Figure 6-3

6.5 Assembly

⚠ WARNING

For your own safety, **DO NOT** connect the machine to the power source until the machine is completely assembled and you read and understand the entire instruction manual.

6.5.1 Attaching the Legs

25. Use slings to remove the magnet body from the crate. Rest the body on wooden blocks.
26. Attach the feet to columns using the M8x16 button-head screws. Install the feet under the columns with the short end forward. Left foot shown (fig. 6-4).
27. Tighten the button head screws securely.
28. Carefully lay the brake on its side and then place in an upright position with a suitable lifting device.

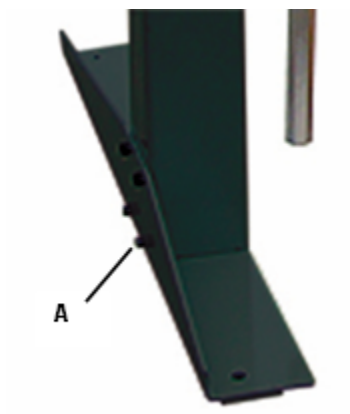


Figure 6-4

6.5.2 Tool Tray and Back Gauge Supports

1. Using (3) M8x12 socket cap screws attach the tool tray to the back of the brake.
2. Lay the rubber mat into the tray.

3. Attach each back gauge bar to the brake with (2) M8x16 socket cap screws.
4. Tighten securely.
5. Slide a back gauge collar onto each bar as shown in (fig. 6-5).

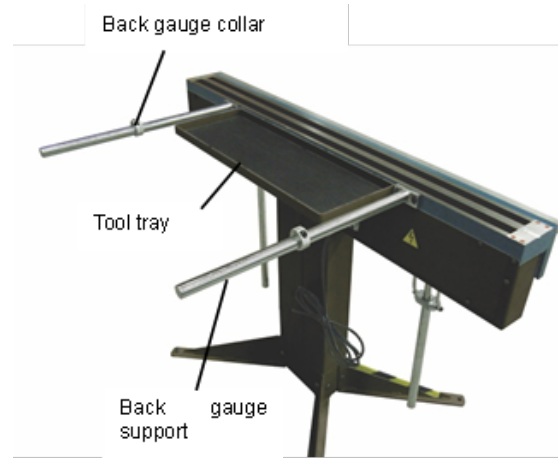


Figure 6-5

6.5.3 Footswitch



Figure 6-6

1. Unstrap and straighten out the footswitch cable.
2. Grasp the connector end and plug into the receptacle at the bottom of the electrical cabinet.
3. Tighten the connector sleeve.

6.5.4 Removing and Installing the Bending Extension Bar

Note: The bending extension is typically on the bending leaf. It can be removed to create shorter reverse bends.

1. Use a marker to mark the top surface of the extension bar.
2. Remove and retain the mounting bolts (A) and remove the extension bar and store with the clamping bars.
3. When installing the extension bar, verify that the bar and the seat on the bending leaf are clean (B) and that no metal chips or dirt will prevent the bar from setting fully into the bending leaf seat.
4. Install the mounting bolts (A) loosely.

5. Verify that the top of the extension bar is flush with the top surface of the bending leaf and tighten the mounting bolts keeping the surfaces flush.

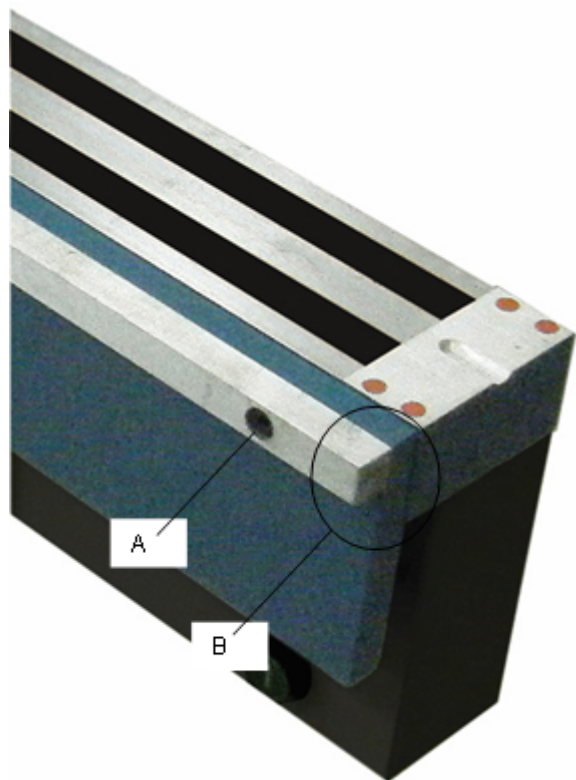


Figure 6-7

7.0 Electrical

⚠ CAUTION

HAVE ELECTRICAL UTILITIES CONNECTED TO MACHINE BY A CERTIFIED ELECTRICIAN!

Check if the available power supply is the same as listed on the machine nameplate.

⚠ WARNING

Make sure the grounding wire (green) is properly connected to avoid electric shock. DO NOT switch the position of the green grounding wire if any electrical plug wires are switched during hookup.

7.1 Power Specifications

Your tool is wired for 220 volts, 60Hz alternating current. Before connecting the tool to the power source, make sure the machine is cut off from power source.

Before switching on the power, you must check the voltage and frequency of the power to see if they meet with the requirement. The allowed range for the frequency is $\pm 1\%$.

IMPORTANT: To achieve proper performance and prevent damage, the power supplied to this machine

must be 220VAC (209VAC to 231VAC). Failure to comply will damage the machine and void the warranty. If needed, contact Baileigh Industrial at 920-684-4990 to purchase a Buck Boost transformer. The service personal will be able to assist in placing the order for the transformer or provide specifications so that you will be able to obtain the proper transformer for your application. Buck-Boost transformers are small single-phase transformers designed to lower (buck) or raise (boost) line voltage from 5-20%.

7.2 Considerations

- Observe local electrical codes when connecting the machine.
- The circuit should be protected with a time delay fuse or circuit breaker with an amperage rating slightly higher than the full load current of machine.
- A separate electrical circuit should be used for your machines. Before connecting the motor to the power line, make sure the switch is in the "OFF" position and be sure that the electric current is of the same characteristics as indicated on the machine.
- All line connections should make good contact. Running on low voltage will damage the motor.
- In the event of a malfunction or breakdown, grounding provides a path of least resistance for electric current to reduce the risk of electric shock. This machine is equipped with an electric cord having an equipment-grounding conductor and a grounding plug. The plug must be plugged into a matching outlet that is properly installed and grounded in accordance with all local codes and ordinances.

⚠ WARNING

In all cases, make certain the receptacle in question is properly grounded. If you are not sure, have a qualified electrician check the receptacle.

- Improper connection of the equipment-grounding conductor can result in risk of electric shock. The conductor with insulation having an outer surface that is green with or without yellow stripes is the equipment-grounding conductor. If repair or replacement of the electric cord or plug is necessary, do not connect the equipment-grounding conductor to a live terminal.
- Check with a qualified electrician or service person if the grounding instructions are not completely understood, or if in doubt as to whether the machine is properly grounded.
- Repair or replace damaged or worn cord immediately.

7.3 Power Cord Connection

1. Verify that power is turned OFF on the control panel and the power source.
2. Unwrap the power cord and route the cord away from the machine toward the power supply.
 - a. Route the power cord so that it will NOT become entangled in the machine in any way.
 - b. Route the cord to the power supply in a way that does NOT create a trip hazard.
3. Connect the power cord to the power supply and check that the power cord has not been damaged during installation.
4. When the machine is clear of any obstruction. The main power switch may be turn ON to test the operation. Turn the switch OFF when the machine is not in operation.

8.0 Operation

⚠ CAUTION

Always wear proper eye protection with side shields, safety footwear, and leather gloves to protect from burrs and sharp edges. When handling large heavy materials make sure they are properly supported. Keep hands and fingers clear of the clamping beam. Stand off to the side of the machine to avoid getting hit with the bending apron as it comes up to bend. The bending brake poses a pinching hazard. Make sure no body part or clothing comes between the clamping bar and the bending leaf.

IMPORTANT: DO NOT run the magnetic brake without material between the clamping bar and the electromagnetic work bench. After releasing the electromagnet, residual magnetism could still hold down the clamp bar.

8.1 Sheet Metal Bending

1. If you are using the clamp bars with the lifting balls, make sure they are both properly seated in the pockets of the workbench. (fig. 8-1)
2. Remove or install the bending leaf extension as needed for the material to be formed.

Note: The bending extension is typically on the bending leaf. It can be removed to create shorter reverse bends. When forming around round stock as in Rolling and Edge, the extension bar is typically installed. The bending leaf extension is shown installed.

3. Set the machine for the material thickness you will be bending. Raise the bending leaf 90° as shown in (fig. 8-2). Rotate the knobs on each end of the clamping bar which adjusts the setback distance gap. Set this gap at slightly more than the material thickness to achieve an

accurate bend. There are three positions on the knobs (0 – 1 – 2) which are useful when doing repeat bending.



Figure 8-1

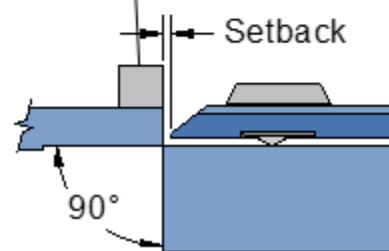


Figure 8-2

4. Press the GREEN power rocker switch to On.

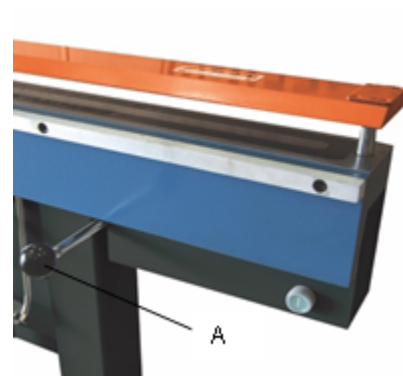


Figure 8-3

5. If using a full-length clamping bar, use the lift handles (A) to raise the clamping bar and then position the piece part under the clamp bar. Use the backstop if needed.

IMPORTANT: NEVER activate the magnetic circuit with the clamping bar raised. The bar will snap down possible causing injury and or damaging the bar, the magnet table, or the material.

6. Lower the clamping bar to allow the weight of the bar to hold the material for final positioning.

7. Switch the toggle switch up to the "BEND" position and step down on the footswitch or press any one of the three GREEN start switches to apply the pre-clamping force. (See fig. 8-4) **IMPORTANT: MAINTAIN THIS AS YOU LIFT THE APRON AND CONTINUE THROUGH STEP 9.**
8. Now that the piece part is held in place, pull up on the bending leaf handles. This will activate the micro-switch which tells the electro-magnet to apply full clamping force. Continue pulling up on the handles until the desired bend angle is made.



Figure 8-4

9. The left handle has a leaf angle indicator that is shown in (fig. 8-5). To allow for springback of the material, bend a few degrees more than the required angle. Read the section Understanding springback. There is also a locking collar on the indicating shaft which can be set and locked to duplicate multiple bends.



Figure 8-5

10. After the bend is made, lower the bending leaf. **DO NOT ALLOW THE BENDING LEAF TO SLAM BACK TO THE LOWER POSITION!** Release the footswitch or GREEN start switch from step 7.
11. Depending on the material used and the magnetic draw, the material may automatically release. If not, Press and hold the stop footswitch or the RED stop button until the clamping bar releases.

Note: When the stop pedal or RED stop button are pressed and held, the internal timer circuit is activated to reverse the current to the magnet creating a demagnetification cycle. This circuit is set to 3 seconds and is used to release the magnetic field on the clamping bar.

IMPORTANT: Each time the machine switches OFF, a short pulse of reverse current is sent through

the electromagnet to demagnetize it as well as the piece part. The timer is set to 2-3 seconds to help collapse the magnetic field.

12. Use the lift handle as needed to lift the clamping bar and reposition the piece part for the next bend and repeat the steps for bending.
13. For thicker gauge materials set the toggle switch in (fig. 8-6) to the CLAMPING FOR BENDING position. When bending very thin materials set the toggle switch to CONTINUOUS LIGHT CLAMPING.



Figure 8-6

Note: Bending in Light Clamping is easier on the brake by reducing the electrical currents created by the magnetic field as well as reducing heat buildup. This does reduce the clamping force which may allow the clamping bar and or the material to break the magnetic hold and move during the bend. This will vary depending upon material and material thickness. Experiment and take notes of which material allow bending with light clamping and which material require full clamping.

8.2 Bending Edges of Materials

When bending a narrow lip (2" min. [51mm]) on a piece of material it is a good idea to place a piece of filler material under the clamping bar as shown in (fig. 8-7).

This will support the clamping bar, allowing the bar to set flat across the brake body. Using a ferrous material as the filler will aid in maintaining strong magnetic adhesions.

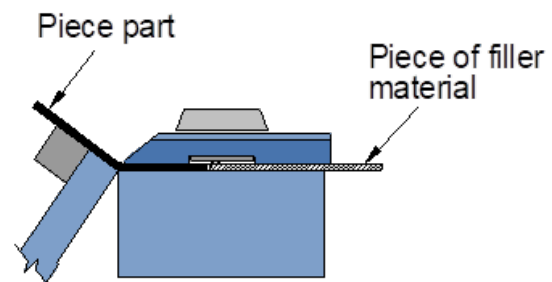


Figure 8-7

IMPORTANT: The material must be at least 2" (51mm) under the clamping bar plus a piece of filler material to allow for full clamping and bending force.

Materials that do not extend to the full depth under the clamping bar will still pose issues with lifting before bending from time to time.

8.3 Magnetism Notes

Heat will reduce the strength of magnetic field. This is important to know when using the magnetic brake for long periods of time. It is recommended to keep the amount of time that the magnetic coils are energized as short as possible.

When the coils of the magnet are energized, the electrical current flowing through the coils creates heat. Keeping the brake in open air and if the ambient temperature is high, it may help to use an external fan to provide some air movement.

NOTICE

This brake has a 30% duty cycle. If the bending bed, (magnet) is too hot to touch then the brake should be completely shut down and allowed to cool to prevent damage to the magnet coils.

Magnetic materials such as the steel used for the clamping bars will become weakly magnetized by being in contact with strong magnets. Over time with use, these bars will gain their own magnetic field. Over time when not in use, this magnetic field will dissipate and weaken.

If the magnetic brake is used daily, this relatively weak magnetic field will remain constant.

Also striking metal bars with a hammer can create a temporary weak magnet. This is important to know with regard to handling the clamping bars.

First, the clamping bars should be handled carefully to prevent damage and bending. Additionally, if the bars are dropped or moved around roughly, this can cause the natural magnetic field created from usage to strengthen slightly as well as last longer.

This can cause some issues with the clamping bars releasing after a bend.

Use sources such as library or the internet to find methods for de-magnetizing steel if the clamping bars become too magnetized to use effectively.

9.0 Bending Allowance

To bend sheet metal accurately, you will need to consider the total length of each bend. This is referred to as bend allowance. Subtract the bend allowance from the sum of the outside dimensions of the piece part to obtain the actual overall length or width of the piece. Because of differences in sheet metal hardness, and whether the bend is made with the grain or against it, exact allowances must sometimes be made by trial and error. However, bend allowances for general use can be obtained from metal working books or from the Internet.

10.0 Understanding Springback

Springback, also known as elastic recovery, is the result of the metal wanting to return to its original shape after undergoing compression and stretch. After the bending leaf is removed from the metal and the load is released, the piece part relaxes, forcing the bent portion of the metal to return slightly to its original shape. The key to obtaining the correct bend angle is to over bend the metal a little and allow it to spring back to the desired angle. All metals exhibit a certain amount of spring back.

11.0 Material Selection

CAUTION

It must be determined by the customer that materials being processed through the machine are NOT potentially hazardous to operator or personnel working nearby.

When selecting materials keep these instructions in mind:

- Material must be clean and dry (without oil).
- Material should have a smooth surface so it processes easily.
- Dimensional properties of material must be consistent and not exceed the machine capacity values.
- Chemical structure of material must be consistent.
- Buy certified steel from the same vendor when possible.

12.0 Bend Configurations

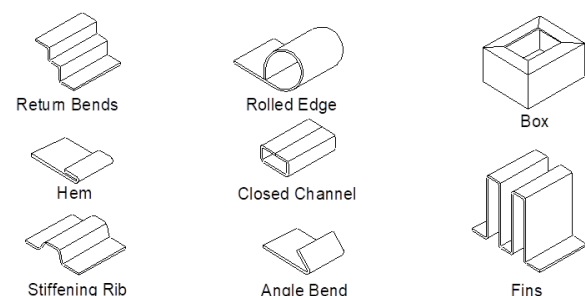


Figure 12-1

13.0 Bending Examples

13.1 Folding Over a Lip

The thickness, width, and length of material are factors to consider when folding a lip. DO NOT exceed 20ga. (.035") for material thickness.

1. With the clamping bar in place and properly secured, bend the material as far as the bending leaf will allow. (Normal bending procedure)

2. Now remove the clamping bar, bring up the bending leaf, and continue the fold as in (fig. 13-1). (No clamping is required.)
3. To further flatten the material, slide the piece part forward about 1/2" and use the bar to magnetically clamp it as shown in (fig. 13-2)

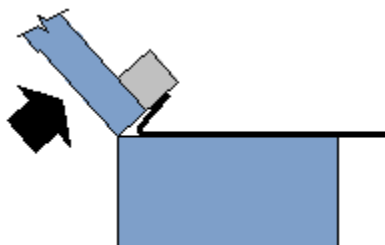


Figure 13-1

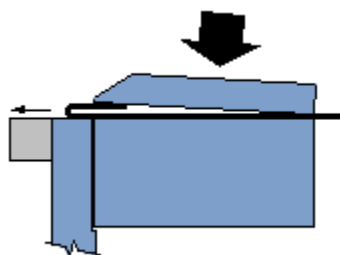


Figure 13-2

13.2 Rolling an Edge

Use a piece of solid steel round or a pipe to accomplish this.

1. Position the clamping bar and the round bar as shown in (fig. 13-3) to ensure that the piece part is positioned correctly. Energize the electromagnet.
2. Raise the bending leaf to make the initial bend.
3. Release the electromagnet and rotate the piece part down to the horizontal position.
4. Continue the above procedure until you are satisfied with the result.

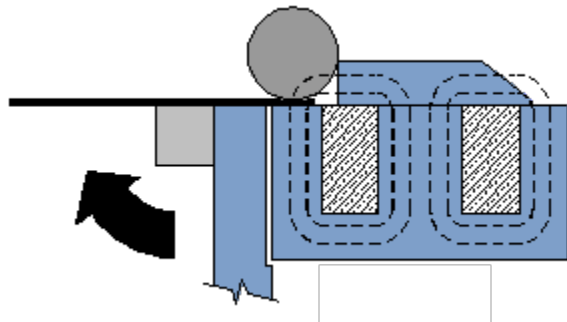


Figure 13-3

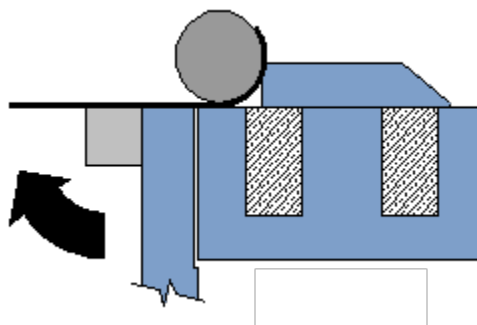


Figure 13-4

13.3 Making a Box with Clamping Bars

1. Using a long clamp bar, initiate the first two bends.
2. Choose and insert one or more of the short clamp bars as shown in (fig. 13-5) below for the opposite bends. (This method allows for deep depth boxes.)
3. Clamping bars can be laid side by side or pinned together for repeat bending of multiple units.

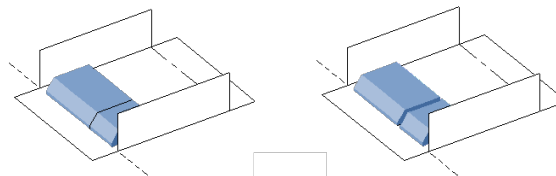


Figure 13-5

13.4 Forming Pans with Slotted Clamp Bar

The slotted clamping bar works great for making shallow pans and trays. The entire clamp bar lifts automatically for easy insertion and removal of the piece part.

1. Fold two opposite sides and the corner tabs with the slotted clamp bar. (The slots will NOT affect these bends.)
2. Select two slots that fit the pan for the remaining bends. The edge of the tray should be under the clamp bar and between the selected slots.

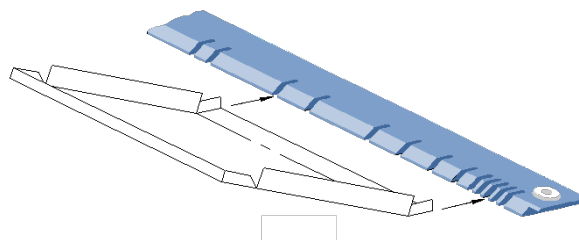


Figure 13-6

14.0 Maintenance

⚠ WARNING

Make sure the electrical disconnect is OFF before working on the machine.

⚠ WARNING

Maintenance should be performed on a regular basis by qualified personnel.

⚠ WARNING

Always follow proper safety precautions when working on or around any machinery.

- Check daily for any unsafe conditions and fix immediately.
- Check that all nuts and bolts are properly tightened.
- On a weekly basis clean the machine and the area around it.
- Lubricate threaded components and sliding devices.
- Apply rust inhibitive lubricant to all non-painted surfaces.

Note: Proper maintenance can increase the life expectancy of your machine.

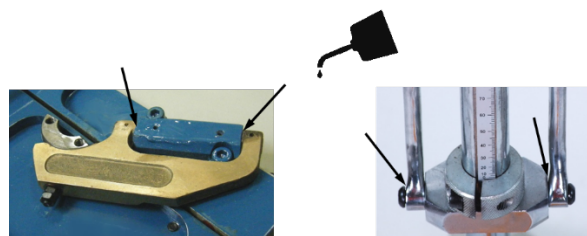


Figure 14-1

14.1 Checking Machine Accuracy

To achieve and maintain accurate bends on the Baileigh BB-7216M-V2 magnetic brake, the working surface of the bending beam and the bending edge of the clamp bar need to be straight. Both surfaces must also be parallel to each other. This can be checked periodically with a precision straight edge.

14.2 Checking the Gap

1. Raise the bending leaf up to a 90° position as shown in (fig. 14-2).
2. Secure with the locking collar (fig. 14-3) on the leaf angle indicator arm.
3. Set the gap between the working surface of the bending leaf and the edge of the clamping bar to .039" +/- .008" by using the clamp bar adjusters (fig. 14-4).
4. The adjuster knobs should be set the same at each end of the clamp bar.

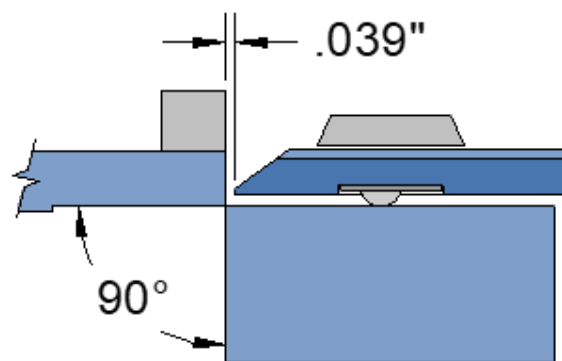


Figure 14-2

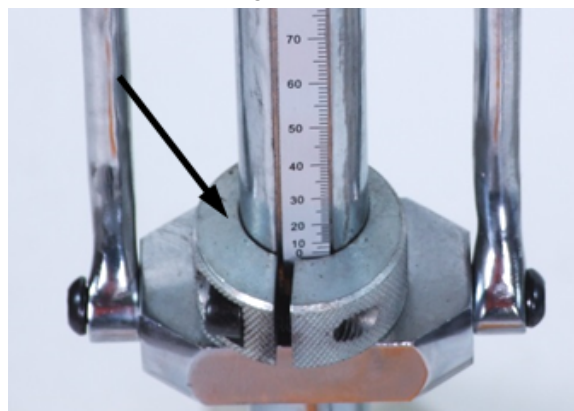


Figure 14-3



Figure 14-4

15.0 Troubleshooting

WARNING

Make sure the electrical disconnect is OFF before working on the machine.

Table 15-1

Fault	Probable Cause	Remedy
MACHINE DOES NOT OPERATE	Machine is not plugged in to a live circuit.	Have qualified electrician check circuit.
	Bending leaf lifted before start button is pressed.	Return bending leaf to lower position and press start button.
	Bending leaf micro-switch out of adjustment.	Adjust bending leaf micro-switch to be pressed in when leaf is in the released position.
	Machine power switch is not lit.	Push switch to ON position and make sure light is ON.
	The machine is hot and overheated.	Let the machine cool and try to start again.
	Bending leaf is raised before starting machine.	Do Not lift the bending leaf prior to starting the machine.
	Start pushbutton is faulty.	Try to start with the footswitch, if it starts, replace the start switch.
	Loose connection	Check the connector and magnet at the electrical module (Electrician Only)
	Clamp bar snaps down on the release of the start button.	Replace the 15 microfarad capacitor.
	Blown fuses or tripped circuit breakers.	Bridge rectifier may be blown.

15.1 Full Clamping Not Operating

If you are not achieving a full clamp, the angle micro switch may not be fully actuated.

To check that the angle micro switch is being fully actuated.

- The micro switch can be found on the electrical panel located at the end of the square brass section. The brass section is attached to the angle indicating mechanism.
- To access the electrical panel, the rear cover must be removed.
- When the bending beam is lifted this rotates the brass section which in turn depresses the micro switch. You should be able to hear the micro switch click on and off.
- Failing this, adjust the clutching force. This can be done by ensuring that two M8 cap head screws at either end of the actuator shaft is secured.
- This adjustment should ensure that the actuator rotates and clutches, however, if you are still unable to hear the click, the micro switch may need adjusting.
- The actuator can be adjusted by loosening the screw that secures it, making the adjustment, followed by re-tightening the screw.

- If the micro switch does not click on and off after you have made the above adjustments and rotated the bending beam to the maximum stops, then the switch may be fused and would need to be replaced. Call or email your distributor.

15.2 Clamp Bar Not Being Released

This is caused by the failure of the reverse pulse de-magnetizing circuit. Check for sticky contacts on the relay and clean.


The 6.8 power resistor or diodes could be faulty which will have to be replaced.

Problem with the bending of heavy gauge sheet metal

- Ensure that sheet metal thickness is within the specifications of the machine.
- It may occur if narrow lips are being bent over the full length of the machine, please note that the machine is not equipped to do this.
- Should the work piece not be level (i.e. have a welded seam or a joint) it may not be possible to bend the work piece. Ensure that all spaces under the clamp bar are filled with flat pieces of scrap metal.

16.0 Replacement Parts

16.1.1 Magnetic Box and Pan Brake Assembly – Exploded View

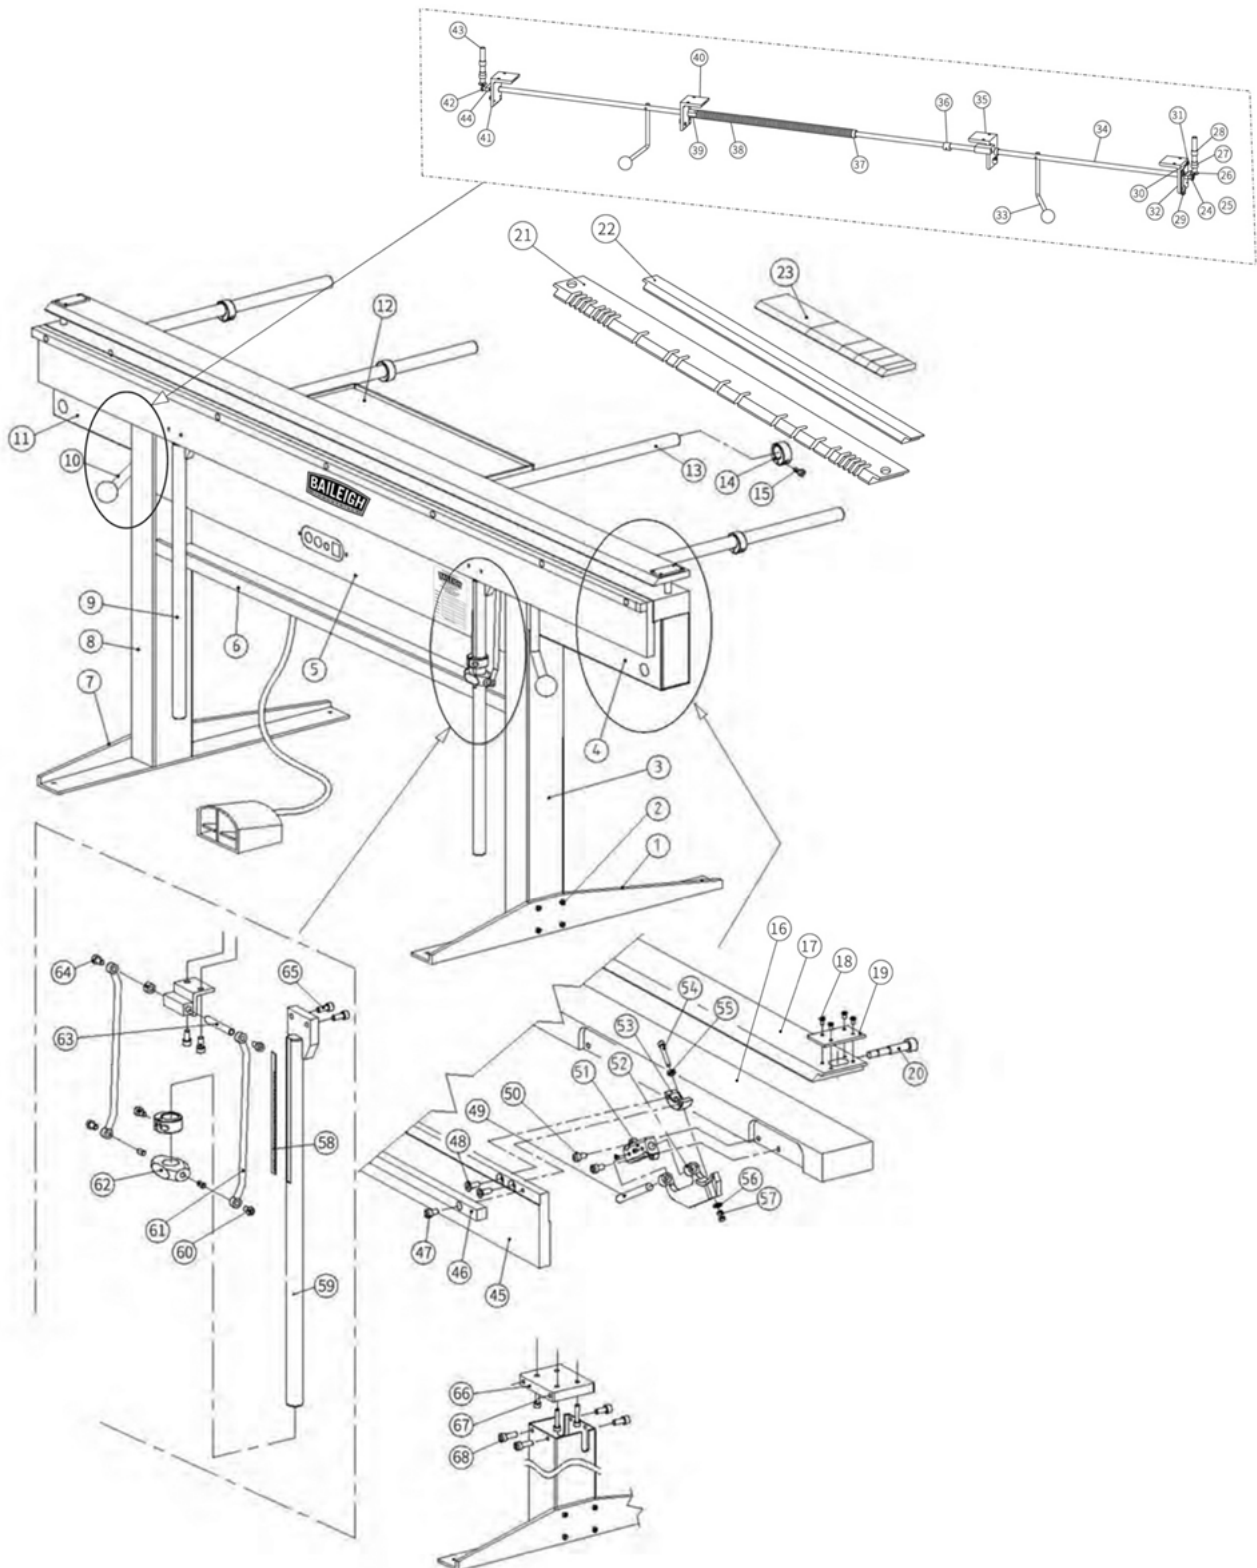


16.1.2 Magnetic Box and Pan Brake Assembly – Parts List

Index No.	Part No.	Description	Size	Qty
1	BA1-118	Right Foot		1
2	JT9-TS-2249162	Hex Socket Button Head Screw	M10x16	8
3	BA1-119	Right Columns		1
4	BA1-708	Right Cover		1
5	BA1-121	Central Cover		1
6	BA1-122	Storage Shelf		1
7	BA1-123	Left Foot		1
8	BA1-124	Left Columns		1
9	BA1-125	Handle		1
10	BA1-126	Left Lifter Handle		1
11	BA1-709	Left Cover		1
12	BA1-128	Tray		1
13	BA1-129	Back Stop Bar		4
14	BA1-130	Stop Collar		5
15	JT9-TS-1504041	Hex Socket Head Cap Screw	M8x20	5
16	BA1-710	Workbench		1
17	BA1-711	Clamp Bar		1
18	JT9-TS-2245102	Hex Socket Button Head Screw	M5x10	8
19	BA1-133	Cover Adjust Plate		2
20	BA1-134	Cover Adjust Screw		2
21	BA1-135	Slotted Clamping Bar		1
22	BA1-136	Narrow Clamping Bar		1
23	BA1-137	Short Clamping Bar Set		1
24	BA1-138	Lifter Roller		2
25	BA1-139	Follower Screw		1
26	BA1-140	Lifter Pad		2
27	BA1-141	Flanged Lifter Bushing		5
28	BA1-142	Lifter Bushing		2
29	BA1-143	Lifter Toggle		1
30	BA1-144	Toggle Pivot		1
31	JT9-TS-2246162	Hex Socket Button Head Screw	M6x15	3
32	BA1-145	#4 Lifter Bracket		1
33	BA1-146	Right Lifter Handle		1
34	BA1-712	Lifter Shaft		1
35	BA1-148	#3 Lifter Bracket		1
35-1	CM9-TS-1504031	Hexagon Socket Head Cap Screw (not shown)	M8x16	8
36	BA1-149	Micro Switch Cam		1
37	BA1-150	Torsion Spring Coupler		1
38	BA1-151	Lifter Spring		1
39	BA1-152	Torsion Spring Adjuster		1
40	BA1-153	#2 Lifter Bracket		1
41	BA1-154	#1 Lifter Bracket		1
42	BA1-155	Lifter Roller Standoff		2
43	BA1-156	Lifter Pin		2
44	BA1-157	Lifter Arm		2
45	BA1-713	Bending Beam		1
46	BA1-714	Bending Beam Extension		1
47	JT9-TS-1504041	Hex Socket Head Cap Screw	M8x20	8
48	BA1-237	Cross Recessed Countersunk Screw	M8x20	12
49	BA1-1969	Straight Pin	12x100	6
50	JT9-TS-1504041	Hexagon Socket Head Cap Screw	M8x20	12
51	BA1-222	Fixed Set		6
52	BA1-223	Hinge Body		6
53	BA1-224	Tee		6
54	BA1-225	Bolt		6
55	BA1-226	Ball Seat		6
56	BA9-1970	Disc Spring		6
57	CM9-TS-2311061	Nut	M6	12
58	BA1-214	Graduated Scale		1

Index No.	Part No.	Description	Size	Qty
59	BA1-215	Left Clamp Handle		1
60	JT9-TS-1504041	Hex Socket Head Cap Screw	M8x20	2
61	BA1-216	Connect Plate		2
62	BA1-217	Slider		1
63	BA1-219	Shaft		1
64	BA1-160	Block		1
65	CM9-TS-1504031	Hex Socket Head Cap Screw	M8x16	2
66	BA1-161	Connect Plate		1
67	JT9-TS-1504061	Hex Socket Head Cap Screw	M8x30	8
68	CM9-TS-1504031	Hex Socket Head Cap Screw	M8x16	8
69	BA1-11866	Pan Head Screw	M6x8	21

17.0 Wiring Diagram

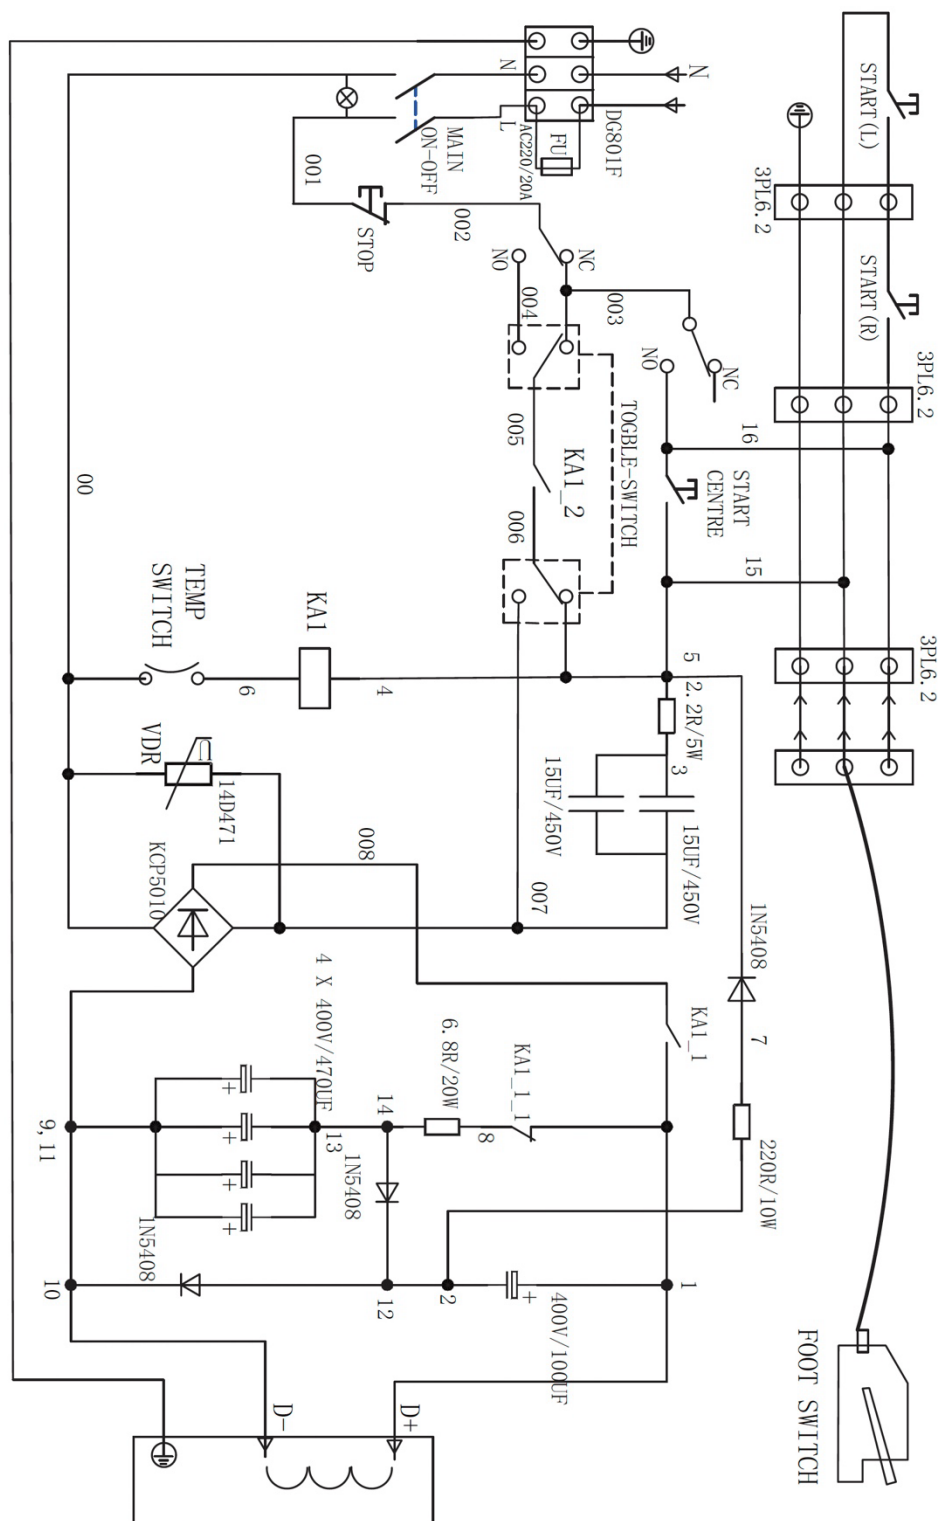

17.1 Wiring Components

Index No.	Part No.	Description	Size	Qty
1	BA1-164	DG801F, Power Port, 20A		1
2	BA1-165	KCD4, Main On - Off		1
3	BA1-166	ZB2-BE102C, Red Stop Push Button		1
4	BA1-167	XV-153-1C25, NC Contact, NO Contacts		2
5	BA1-168	ZB2-BE101C, Green Start Push Button		1
6	BA1-169	KCD4, Toggle Switch		1
7	BA1-170	KSD301, Temp Switch		1
8	BA1-171	RPF2BP7, Relay		1
9	BA1-172	2.2R/5W, R1 (Resistor)		1
10	BA1-173	220R/10W, R2 (Resistor)		1
11	BA1-174	6.8R/20W, R3 (Resistor)		1
12	BA1-175	15UF/450V, C1 (Capacitor)		2
13	BA1-176	4701UF/400V, C2 (Capacitor)		4
14	BA1-177	47UF/400V, C3 (Capacitor)		1
15	BA1-178	14D471, Piezo Resistor		1
16	BA1-179	KCP5010, Bridge Rectifier		1
17	BA1-180	1N5408, D1(Diode)		3
18	BA1-181	3P-L6.2, Plug Connector		4
19	BA1-182	Foot Switch		1
20	BA1-4303	BGXP 5x20, 20A Fuse		1

18.0 Warranty and Service

Thank you for your purchase of a machine from Baileigh Industrial. We hope that you find it productive and useful to you for a long time to come.

Inspection & Acceptance. Buyer shall inspect all Goods within ten (10) days after receipt thereof. Buyer's payment shall constitute final acceptance of the Goods and shall act as a waiver of the Buyer's rights to inspect or reject the Goods unless otherwise agreed. If Buyer rejects any merchandise, Buyer must first obtain a Returned Goods Authorization ("RGA") number before returning any Goods to Seller. Goods returned without an RGA will be refused. Seller will not be responsible for any freight costs, damages to Goods, or any other costs or liabilities pertaining to Goods returned without an RGA. Seller shall have the right to substitute a conforming tender. Buyer will be responsible for all freight costs to and from Buyer and repackaging costs, if any, if Buyer refuses to accept shipment. If Goods are returned in unsalable condition, Buyer shall be responsible for full value of the Goods. Buyer may not return any special-order Goods. Any Goods returned hereunder shall be subject to a restocking fee equal to 30% of the invoice price.

Specifications. Seller may, at its option, make changes in the designs, **specifications**, or components of the Goods to improve the safety of such Goods, or if in Seller's judgment, such changes will be beneficial to their operation or use. Buyer may not make any changes in the specifications for the Goods unless Seller approves of such changes in writing, in which event Seller may impose additional charges to implement such changes.

Limited Warranty. Seller warrants to the original end-user that the Goods manufactured or provided by Seller under this Agreement shall be free of defects in material or workmanship for a period of twelve (12) months from the date of purchase, provided that the Goods are installed, used, and maintained in accordance with any instruction manual or technical guidelines provided by the Seller or supplied with the Goods, if applicable. The original end-user must give written notice to Seller of any suspected defect in the Goods prior to the expiration of the warranty period. The original end-user must also obtain an RGA from Seller prior to returning any Goods to Seller for warranty service under this paragraph. Seller will not accept any responsibility for Goods returned without an RGA. The original end-user shall be responsible for all costs and expenses associated with returning the Goods to Seller for warranty service. In the event of a defect, Seller, at its sole option, shall repair or replace the defective Goods or refund to the original end-user the purchase price for such defective Goods. Goods are not eligible for replacement or return after a period of 10 days from date of receipt. The foregoing warranty is Seller's sole obligation, and the original end-user's exclusive remedy, with regard to any defective Goods. This limited warranty does not apply to: (a) die sets, tooling, and saw blades; (b) periodic or routine maintenance and setup, (c) repair or replacement of the Goods due to normal wear and tear, (d) defects or damage to the Goods resulting from misuse, abuse, neglect, or accidents, (f) defects or damage to the Goods resulting from improper or unauthorized alterations, modifications, or changes; and (f) any Goods that has not been installed and/or maintained in accordance with the instruction manual or technical guidelines provided by Seller.

EXCLUSION OF OTHER WARRANTIES. THE FOREGOING LIMITED WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED. ANY AND ALL OTHER EXPRESS, STATUTORY, OR IMPLIED WARRANTIES, INCLUDING BUT NOT LIMITED TO, ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE ARE EXPRESSLY DISCLAIMED. NO WARRANTY IS MADE WHICH EXTENDS BEYOND THAT WHICH IS EXPRESSLY CONTAINED HEREIN.

Limitation of Liability. IN NO EVENT SHALL SELLER BE LIABLE TO BUYER OR ANY OTHER PARTY FOR ANY INCIDENTAL, CONSEQUENTIAL OR SPECIAL DAMAGES (INCLUDING, WITHOUT LIMITATION, LOST PROFITS OR DOWN TIME) ARISING FROM OR IN MANNER CONNECTED WITH THE GOODS, ANY BREACH BY SELLER OR ITS AGENTS OF THIS AGREEMENT, OR ANY OTHER CAUSE WHATSOEVER, WHETHER BASED ON CONTRACT, TORT OR ANY OTHER THEORY OF LIABILITY. BUYER'S REMEDY WITH RESPECT TO ANY CLAIM ARISING UNDER THIS AGREEMENT IS STRICTLY LIMITED TO NO MORE THAN THE AMOUNT PAID BY THE BUYER FOR THE GOODS.

Force Majeure. Seller shall not be responsible for any delay in the delivery of, or failure to deliver, Goods due to causes beyond Seller's reasonable control including, without limitation, acts of God, acts of war or terrorism, enemy actions, hostilities, strikes, labor difficulties, embargoes, non-delivery or late delivery of materials, parts and equipment or transportation delays not caused by the fault of Seller, delays caused by civil authorities, governmental regulations or orders, fire, lightning, natural disasters or any other cause beyond Seller's reasonable control. In the event of any such delay, performance will be postponed by such length of time as may be reasonably necessary to compensate for the delay.

Installation. If Buyer purchases any Goods that require installation, Buyer shall, at its expense, make all arrangements and connections necessary to install and operate the Goods. Buyer shall install the Goods in accordance with any Seller instructions and shall indemnify Seller against any and all damages, demands, suits, causes of action, claims and expenses (including actual attorneys' fees and costs) arising directly or indirectly out of Buyer's failure to properly install the Goods.

Work By Others; Safety Devices. Unless agreed to in writing by Seller, Seller has no responsibility for labor or work performed by Buyer or others, of any nature, relating to design, manufacture, fabrication, use, installation, or provision of Goods. Buyer is solely responsible for furnishing and requiring its employees and customers to use all safety devices, guards and safe operating procedures required by law and/or as set forth in manuals and instruction sheets furnished by Seller. Buyer is responsible for consulting all operator manuals, ANSI or comparable safety standards, OSHA regulations and other sources of safety standards and regulations applicable to the use and operation of the Goods.

Remedies. Each of the rights and remedies of Seller under this Agreement is cumulative and in addition to any other or further remedies provided under this Agreement or at law or equity.

Attorney's Fees. In the event legal action is necessary to recover monies due from Buyer or to enforce any provision of this Agreement, Buyer shall be liable to Seller for all costs and expenses associated therewith, including Seller's actual attorney fees and costs.

Governing Law/Venue. This Agreement shall be construed and governed under the laws of the State of Wisconsin, without application of conflict of law principles. Each party agrees that all actions or proceedings arising out of or in connection with this Agreement shall be commenced, tried, and litigated only in the state courts sitting in Manitowoc County, Wisconsin or the U.S. Federal Court for the Eastern District of Wisconsin. Each party waives any right it may have to assert the doctrine of "forum non conveniens" or to object to venue to the extent that any proceeding is brought in accordance with this section. Each party consents to and waives any objection to the exercise of personal jurisdiction over it by courts described in this section. Each party waives to the fullest extent permitted by applicable law the right to a trial by jury.

Summary of Return Policy:

- 10 Day acceptance period from date of delivery. Damage claims and order discrepancies will not be accepted after this time.
- You must obtain a Baileigh Industrial issued RGA number PRIOR to returning any materials.
- Returned materials must be received at Baileigh Industrial in new condition and in original packaging.
- Altered items are not eligible for return.
- Buyer is responsible for all shipping charges.
- A 30% re-stocking fee applies to all returns.

Baileigh Industrial makes every effort to ensure that our posted specifications, images, pricing, and product availability are as correct and timely as possible. We apologize for any discrepancies that may occur. Baileigh Industrial reserves the right to make any and all changes deemed necessary in the course of business including but not limited to pricing, product specifications, quantities, and product availability.

For Customer Service & Technical Support:

Please contact one of our knowledgeable Sales and Service team members at:
(920) 684-4990 or e-mail us at Baileigh-Service@jpwindustries.com

[illegible]

[illegible]

This image shows a blank sheet of white paper with horizontal ruling lines. The lines are evenly spaced and extend across the width of the page. There are no margins, text, or other markings on the paper.



BAILEIGH INDUSTRIAL

1625 DUFEK DRIVE MANITOWOC, WI 54220

PHONE: 920.684.4990 FAX: 920.684.3944

www.baileigh.com